

- Legend**
- EXISTING TREE TO REMAIN
 - TREE NUMBER
 - EXISTING TREE TO BE REMOVED
 - EXISTING CONDITION PHOTO VIEW
 - TREE PROTECTION FENCE

1 Tree Protection Plan Scale: 1:250

Tag#	Species	Common Name	DBH (cm)	Canopy Spread	Condition	Remarks	Tree Location	Tree Status	TPZ distance from trunk (m)	Replacement QTY
214	<i>Gleditsia triacanthos</i>	Honeylocust	38	8	Good		Private	Remove	5	2
215	<i>Tilia cordata</i>	Little Leaf Linden	28	6	Fair	Frost crack on west side of trunk, minor branch tip dieback	Private	Remove	4	1
216	<i>Thuja occidentalis</i>	White Cedar	26, 22	2	Good	Two trunk clump	Private	Remove	2	1
217	<i>Thuja occidentalis</i>	White Cedar	19, 18, 18	2	Good	Three trunk clump	Private	Remove	2	1
218	<i>Pinus nigra</i>	Austrian Pine	33	4	Poor	Canopy damage due to diplodia tip blight, trunk leaning east.	Private	Remove	3	2
219	<i>Picea pungens</i>	Colorado Spruce	11	1	Good	New tree planting on adjacent site	Private	Preserve	1.5	0
220	<i>Quercus robur</i>	Pyramidal English Oak	6	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
221	<i>Quercus robur</i>	Pyramidal English Oak	6	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
222	<i>Quercus robur</i>	Pyramidal English Oak	11	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
223	<i>Quercus robur</i>	Pyramidal English Oak	6	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
224	<i>Quercus robur</i>	Pyramidal English Oak	7	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
225	<i>Quercus robur</i>	Pyramidal English Oak	6	1	Dead	Tree is dead	Private	Remove	1.5	0
226	<i>Quercus robur</i>	Pyramidal English Oak	6	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
227	<i>Quercus robur</i>	Pyramidal English Oak	4	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0
227a	<i>Prunus avium</i>	Domestic Cherry	10	3	Poor	Tree in adjacent property, trunk and limbs infected with canker decay	Private	Preserve	2.5	0
227b	<i>Prunus avium</i>	Domestic Cherry	10	3	Poor	Tree in adjacent property, part of canopy is dead due to fungal decay	Private	Preserve	2.5	0
228	<i>Quercus robur</i>	Pyramidal English Oak	7	1	Good	New tree planting, tree stakes and ties wrapped around trunk.	Private	Remove	1.5	0


2 Tree Information Table

229	<i>Pinus nigra</i>	Austrian Pine	40	8	Good		Private	Remove	5	2
230	<i>Gleditsia triacanthos</i>	Honeylocust	36	8	Good		Private	Remove	5	2
231	<i>Picea pungens</i>	Colorado Spruce	34	4	Good		Private	Remove	3	2
232	<i>Pinus nigra</i>	Austrian Pine	35	5	Fair	Trunk leaning south, included bark between 2 co-dominant leaders 2m from grade.	Private	Remove	3.5	2
233	<i>Tilia cordata</i>	Little Leaf Linden	39	6	Good		Private	Remove	4	2
234	<i>Picea pungens</i>	Colorado Spruce	32	4	Poor	Canopy sparse due to needle cast disease, bleeding cankers observed on trunk.	Private	Remove	3	2
235	<i>Gleditsia triacanthos</i>	Honeylocust	42	8	Good		Private	Remove	5	2
236	<i>Acer platanoides</i>	Norway Maple	25	4	Poor	Frost crack on west side of trunk, minor branch tip dieback	Private	Remove	3	1
237	<i>Acer platanoides</i>	Norway Maple	30	4	Poor	Frost crack on west side of trunk, severe branch tip dieback	Private	Remove	3	2
238	<i>Acer platanoides</i>	Norway Maple	32	6	Good		Private	Remove	4	1
239	<i>Acer platanoides</i>	Norway Maple	36	6	Poor	Tree in decline, 1/2 of canopy dead and removed by others	Private	Remove	4	1
240	<i>Ulmus pumila</i>	Siberian Elm	31, 22, 19, 19	8	Good	4 trunk clump	Private	Preserve	5	0
241	<i>Ulmus pumila</i>	Siberian Elm	39, 39	8	Good	2 trunk clump	Private	Preserve	5	0
242	<i>Acer negundo</i>	Manitoba Maple	25, 14	6	Poor	2 trunk clump, base of tree growing from the root flare of tree 241	Private	Preserve	4	0
243	<i>Ulmus pumila</i>	Siberian Elm	17	2	Poor	Part of hedge, branch fall observed in canopy	Private	Preserve	2	0
244	<i>Ulmus pumila</i>	Siberian Elm	27	2	Poor	Tree in decline, branch fall observed in canopy	Private	Preserve	2	0
245	<i>Ulmus pumila</i>	Siberian Elm	17	3	Poor	Tree canopy leaning north	Private	Preserve	2.5	0
246	<i>Ulmus pumila</i>	Siberian Elm	18	2	Poor	Part of hedge, branch fall observed in canopy	Private	Preserve	2	0
247	<i>Ulmus pumila</i>	Siberian Elm	26	4	Poor	Trunk fused to tree 248.	Private	Preserve	3	0

248	<i>Ulmus pumila</i>	Siberian Elm	14	2	Hazard	Tree trunk hollow, severe canopy dieback	Private	Preserve	2	0
249	<i>Ulmus pumila</i>	Siberian Elm	18	3	Poor	North trunk severely pruned in the past	Private	Preserve	2.5	0
250	<i>Ulmus pumila</i>	Siberian Elm	25	3	Good	Minor branch fall in canopy	Private	Preserve	2.5	0
251	<i>Ulmus pumila</i>	Siberian Elm	17	2	Poor	Severe branch fall in canopy	Private	Preserve	2	0
252	<i>Ulmus pumila</i>	Siberian Elm	21	2	Poor	Top of tree collapsed	Private	Preserve	2	0
253	<i>Ulmus pumila</i>	Siberian Elm	19, 15	2	Poor	Two trunk clump, canopy dieback	Private	Preserve	2	0
254	<i>Ulmus pumila</i>	Siberian Elm	23	4	Fair	Canopy lopsided favoring west side of trunk.	Private	Preserve	3	0
255	<i>Ulmus pumila</i>	Siberian Elm	19	2	Poor	Minor branch fall in canopy, canopy leaning west	Private	Preserve	2	0
256	<i>Thuja occidentalis</i>	White Cedar	19	2	Fair	2 leaders originating from trunk at 1m from grade, included bark between leaders.	Private	Preserve	2	0
257	<i>Acer negundo</i>	Manitoba Maple	31	6	Hazard	Tree trunk severely girdled by adjacent wood fence, fall hazard.	Private	Remove	4	2
257a	<i>Picea pungens</i>	Colorado Spruce	10	2	Good	Tree on adjacent property	Private	Preserve	2	0
257b	<i>Picea pungens</i>	Colorado Spruce	10	2	Good	Tree on adjacent property	Private	Preserve	2	0
258	<i>Acer saccharinum</i>	Silver Maple	86	12	Good	5 leader at 1.5m from grade, good canopy vigor	City	Preserve	7	0
259	<i>Picea glauca</i>	White Spruce	50	6	Good	Tree located in adjacent property	Private	Preserve	4	0
260	<i>Picea glauca</i>	White Spruce	48	6	Good	Tree located in adjacent property	Private	Preserve	4	0
261	<i>Picea glauca</i>	White Spruce	29	4	Good	Tree located in adjacent property	Private	Preserve	3	0
262	<i>Acer negundo</i>	Manitoba Maple	21, 20, 19, 14	4	Poor	Tree growing adjacent to building foundation, canopy leaning northwest	Private	Remove	3	1
263	<i>Prunus avium</i>	Bird Cherry	45	5	Poor	Cavity decay observed in junction between main lateral limbs in canopy, 2 main lateral limbs occur at 1m from grade.	City	Preserve	3.5	0
264	<i>Prunus avium</i>	Bird Cherry	65, 45	6	Poor	Frost crack on south trunk, cavity decay observed on north leaning trunk	City	Preserve	4	0
									Total Replacement Qty =	29

No	Date	Revisions	By
1.0	05.22.2019	ISSUED FOR REZONING	GM

The drawings, as an instrument of service, are provided for use in the project of the client. The contractor shall check and verify all dimensions and report all errors and omissions to the landscape architect prior to any work. During the project, any changes to the drawings shall be made by written agreement between the parties.

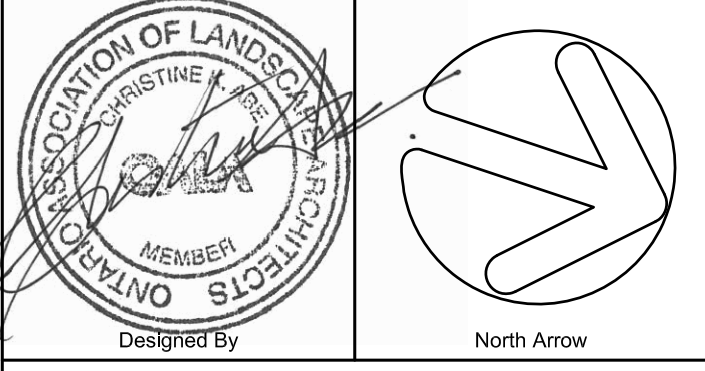

the mbtw group
 235 Wickham Ave., Unit 1A, Toronto, Ontario, Canada M6H 1S8
 T: (416) 448-1707 F: (416) 448-1803 | www.mbtw.com

Project Name:
Liverpool House
 1294 Kingston Road
 City of Pickering

Sheet Title:
Tree Protection Plan

Designed: GM	Drawn: EA	Scale: 1:250	Drawing No.: TP-1
Date of Drawing: January 2019	Job No.: ADG001		